





Certified Inspection Report for: Wylam Parish Council Parish Council Office, Wylam Institute Church Road, Wylam, Northumberland NE41 8AP			Contact: Marie Moore Tel: 01661 852 498 / 07903 663 680 Email:- clerk@wylamparishcouncil.org.uk	Order No: 407030	Site Address: Hagg Bank Play Area Off Wylam Wood Road, Wylam NE41 8JT (Right over bridge. Access via track opposite No. 6.)	SHEET 1 of 3		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
City Spinner on Grass	Playdale 2010	L	Recommend grounds maintenance as required to reduce hazards at areas of ground erosion and exposed concrete.					
1.9m 1 Bay Swing	Playdale 2010		Generally satisfactory, but monitor minor damage to the front 2 timber posts, possibly by small bullets or similar. Note that seats are fitted slightly higher than usual, at approximately 650mm above ground level. Refer to the manufacturer for advice.					
2 x Cradle Seats on Grass		L	Monitor perishing on rubber parts for choking hazards. See right for cost to replace the seats as required.	2	5901-048	Single Tier Rubber Cradle Seat	£125.00	£250.00
		L	Recommend seats are cleaned as required, and intrusive foliage is cut back as required to allow safe use of the swing.			Delivery cost	£21.25	£21.25
Roundabout Ref CMOR on Grass	Playdale 2010	L	Generally satisfactory, but recommend grounds maintenance as required at areas of ground erosion.			Labour to replace the seats if required	Price upon request	
Grass Surface			Grass is considered suitable for use where Free Fall Height is up to 1.5m, but note that grass must be in a well maintained condition, with at least 150mm of soil beneath it. Grass should remain throughout the year, and not become mud or bare earth. Its impact absorbency is dependant on the roots maintaining an uncompacted soil structure. Grass will not sustain intensive use, and is therefore not recommended for areas such as the centre arc of a swing, the run-out area of a slide, below Fireman's Poles, around the outside of a carousel, or equipment access and exit points. For these relatively small high-wear areas, in order to meet the requirements of BS EN 1176:2017 other surfaces to replace or prevent erosion of the grass are needed, taking care that no trip points or hard edges occur. (Ref BS EN 1176:2017 Part 1 UK National Foreword)					
						Continues on next sheet...		
 		Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : - A J Hayes DATE : - 14. 08. 2019	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£271.25 £0.00 £271.25 See sheet 3		

Certified Inspection Report for: Wylam Parish Council Parish Council Office, Wylam Institute Church Road, Wylam, Northumberland NE41 8AP		Contact: Marie Moore Tel: 01661 852 498 / 07903 663 680 Email:- clerk@wylamparishcouncil.org.uk	Order No: 407030 Site Address: Hagg Bank Play Area Off Wylam Wood Road, Wylam NE41 8JT (Right over bridge. Access via track opposite No. 6.)	SHEET 2 of 3
---	--	--	---	---

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2.6m 2 Bay Swing Ref JSW 2 x Flat Seats 1 x Bowl Seat on Safety Grass	Playdale 2010	L	Satisfactory condition, but see note below for the bowl. There is no secondary means of supporting the swing seat (safety chain) to prevent collapse if the primary joint between the chains and the supporting structure fails (Ref BS EN 1176:2017 Part 2 Section 4.6.3) We have referred this to the manufacturers, and their advice is that the swing bearings wear relatively slowly, and are easily accessible for inspection.					
Tower Slide on Grass	unknown	M L Note	Wood rot evident at base of the timber post nearest to the cradle seat swing. Recommend monitoring at present. Wicksteed are unable to quote for repairs to this item. Handrail missing at 1 side of access ramp creates potential falling hazards. Refer to Playdale for advice. Access ramp has been replaced. Monitor timber condition on all other parts for wood rot and splinter hazards. This item is in generally poor condition. Consider replacing in the longer term.					
Timber Seat	unknown 2016/17		Satisfactory condition.					
Timber Gate		L L	Generally satisfactory, but monitor for potential pinch hazards (minimum 12mm gap recommended, ref BS EN 1176:2017 Part 1, section 4.2.7.6) Recommend intrusive foliage is cut back as required to reduce hazards, in particular at eye level.					
						Continues on next sheet...		

 	Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : - A J Hayes DATE : - 14. 08. 2019	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £271.25 £271.25 See sheet 3
--	--	---	---	---	--

Certified Inspection Report for: Wylam Parish Council Parish Council Office, Wylam Institute Church Road, Wylam, Northumberland NE41 8AP		Contact: Marie Moore Tel: 01661 852 498 / 07903 663 680 Email:- clerk@wylamparishcouncil.org.uk	Order No: 407030 Site Address: Hagg Bank Play Area Off Wylam Wood Road, Wylam NE41 8JT (Right over bridge. Access via track opposite No. 6.)	SHEET 3 of 3
---	--	--	---	---

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Operator's Sign		L	The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2017 clause 8.2.4)			A variety of signs are available from Wicksteed Sales Dept		
General		M	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces)					
		L	Bird faeces present potential health hazards especially where transfer to hands or clothing is likely. Monitor and remove bird faeces as required.					
		L	The area lacks litter facilities (recommended)					
		L	Recommend nettle and bramble growth is cut back as required.					



<p>Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028</p> <p>www.wicksteed.co.uk</p>	INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY : -	PARTS SUB TOTAL	£0.00
		A J Hayes DATE : - 14. 08. 2019	BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS TOTAL COST OF WORKS, EXC VAT	£271.25 £271.25 Price upon request £271.25